

# Informazioni del Servizio

**Service News** 

Fiat Auto S.p.A.

D.M.C. - Servizi al Cliente
Servizi Post Vendita

REPRODUCTION OF TEXT AND ILLUSTRATIONS IS STRICTLY PROHIBITED

2/95

### **Panda**

FIAT

#### 1810 A 201 MA CLUTCH DRIVEN DISC

Service solution for cases of gearbox noise

18 ex 181

Version: 4X4

#### TYPE OF PROBLEM

Noise from gearbox during acceleration/deceleration and rattling during idling.

#### **SERVICE SOLUTION**

Replacing clutch assembly with another specific one with a hysteresis variator and central pre-vibration damper, distributed by the Parts Division under no. 5895224.

#### **Operating cycle**

Replace the clutch assembly with another special one ordered from the Parts Division by quoting no. 5895224, following the instructions given in the Service Manual.

#### Availability of spare parts

Clutch assembly no. 5895224

#### **INFORMATION FOR THE CLAIM**

Operation	Piece	Fault	Position	Time allocation
1810103	1	MA	-	hours 3.40



IF05B5 **95.020** 



# Informazioni del Servizio

**Service News** 

Fiat Auto S.p.A.

D.M.C. - Direzione Post Vendita Servizi Assistenziali

REPRODUCTION OF TEXT AND ILLUSTRATIONS IS STRICTLY PROHIBITED

1/94

**Panda** 

181 01 600 67

1810 A 240 MA

**CLUTCH ASSEMBLY** 

Service solution for cases of noise/difficulties in engaging gears

Version: Petrol 4x4

#### TYPE OF PROBLEM

Clutch noisy/difficulties in engaging gears with pedal fully depressed on account of interference between the spring and the driven disc.

#### SERVICE SOLUTION

Check and/or adjust the clutch pedal travel and, if necessary, replace the assem-

#### **Operating cycle**

Checking clutch pedal travel:

- Make sure that there are no obstacles which restrict the total travel of the clutch pedal (remind the Customer to avoid using extra mats under the pedals).
- Let the clutch release bed in by fully depressing the pedal 3 or 4 times.
- Check that the travel of the clutch pedal between the rest position and the end of travel position (see diagram) is equal to 127 ± 5 mm.

Adjusting clutch pedal travel:


- Working on nut A and lock nut B take care to prevent the rotation of the cable during the adjustment operation.

**NOTE** If after having carried out the operations described above the problem has not been solved, replace the clutch assembly with one ordered from the Parts Division no. 5892499 (supplier Valeo).

Printed 20/04/1994

CARTA RICICLATA 100% A RECYCLED PAPER 100%

IFO4A4

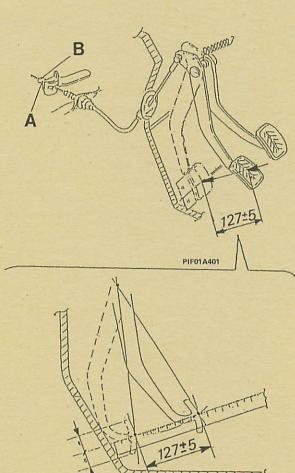

A. Nut B. Lock nut

### **INFORMATION FOR THE CLAIM**

OLD CODE			NEW CODE			
Operation	Piece	Fault	Operation	Piece	Fault	
1810101	1	67	1810101	1	MA	
Time allocation hours 0.50			Time allocation hours 0.50			