

169 - PANDA

SERVICE NEWS > 10 ENGINE > 10.33.10 OIL VAPOUR RECIRCULATION PIPE  
ENGINE OIL VAPOUR RECOVERY PIPE (BLOW-BY) DETERIORATION - SERVICE SOLUTION

1.2 8v

Fino a 06/06

**ADVANCED SEARCH**

**TYPE**

All

**CONTENTS**

Only Titles

Advanced Search

Manual

- Technical Specifications
- Descriptions
- Diagnosis-and-Testing
- Inspection
- Removal-and-Installation
- Electrical equipment

Service News

- Campaigns
- Rapid Check
- Te.Se.O. Newsletters
- TeSeO technical database



## Service News

Copyright By FCA Italy S.p.A. - Printed 09/03/2011



Various Fiat Models

All 1.2 8v and 1.4 8v models, excluding LPG and methane versions - Idea, 500, Panda, Grande Punto, Punto Evo, Linea, Doblò (119 / 223)

10
33.10

**1080 1 581 BC**      **OIL VAPOUR RECIRCULATION PIPE**  
**Engine oil vapour recovery pipe (blow-by) deterioration - Service Solution**

Cancels and replaces SN 10.33.10 of 10/11/2010.

### FAULT COMPLAINED OF

Smell coming from the engine compartment.

### TECHNICAL CAUSE

Deterioration of the engine oil vapour recovery pipe (blow-by), causing leaks and smell.

### OPERATIONS IN PRODUCTION

On 500, Panda, Grande Punto and Punto Evo models: implementation of a new engine oil vapour recovery pipe (blow-by), with improved features; for the other models, the pipe path has been improved.

### IMPLEMENTATION OF MODIFICATION

Version	Factory	Line	Chassis No.	Organisation No.
500	Tychy	-	534957	7174858
Panda	Tychy	-	1736150	3198462
Grande Punto Punto Evo	Melfi	1	667046	1656356
Grande Punto Punto Evo	Melfi	2	1656281	1656352

### OPERATIONS IN NETWORK

#### NETWORK BEHAVIOUR STANDARDS TOWARDS THE CUSTOMER

-Once the claimed fault is confirmed, reassure the Customer that the fault will be solved by fitting a new engine oil vapour recovery pipe (blow-by) with improved features.-After the operation, show the Customer what has been done and make sure he is satisfied.

#### SERVICE SOLUTION

Once the customer's claimed fault is confirmed, replace the engine oil vapour recovery main pipe (blow-by), then check the engine oil vapour recovery pipe at idling speed and, if damaged, replace it according to the Operating Cycle below.

#### OPERATION CYCLE

##### CYCLE A - REPLACEMENT OF THE OIL VAPOUR RECIRCULATION PIPE (BLOW-BY)

-Remove the air filter with cold air intake (A - Fig. 1) operating as described in Op. 1048A10 of the Service Manual;-Loosen the retaining bands (1) and remove the oil vapour recirculation pipe (2) operating as described in Op. 1080D22 or 1080D24 of the Service Manual.-Loosen the fixing band and disconnect the engine oil vapour recovery pipe (3) at idling speed.

Fig. 1

