



Informazioni del Servizio

Service News

Fiat Auto S.p.A.
D.M.C. - Servizi al Cliente
Servizi Post Vendita

FIAT

REPRODUCTION OF TEXT AND ILLUSTRATIONS IS STRICTLY PROHIBITED

4/95

Panda

44

ex 443

4420 D 201 GH REAR SUSPENSION

Service solution for cases in which the vehicle leans to one side

Version: All versions excluding the 4x4

TYPE OF PROBLEM

In running and order and static, the vehicle may tend to lean to one side on account of the particular sensitivity of this type of suspension to variations in the flexibility of the springs even within the tolerance range.

SERVICE SOLUTION

Insert spacer no. 46427846 (A in the diagram) under the rear spring on the side to which it is leaning.

Operating cycle


With the vehicle in running order on a flat surface, detect the side to which the vehicle is leaning.

- Raise the vehicle and, supporting the rear axle with a hydraulic jack, release the rear shock absorbers from the axle.
- Lower the rear axle so that it is possible to insert spacer no. 46427846 under the spring on the side to which the vehicle is leaning.
- Refit the components removed in the reverse order to the removal.

SOLUZIONE ASSISTENZIALE

2/2

SOLUZIONE ASSISTENZIALE

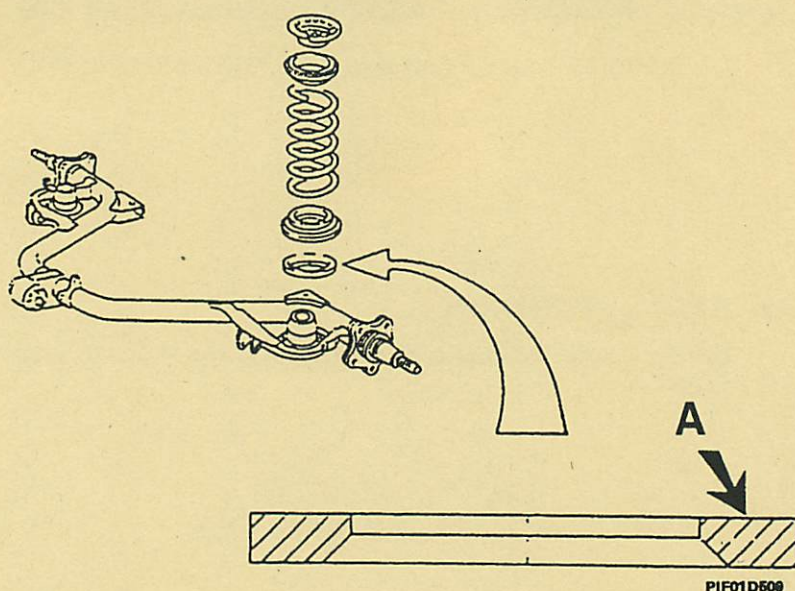

Availability of spare parts

A. Spacer no. 46427846

INFORMATION FOR THE CLAIM

Operation	Piece	Fault	Position	Time allocation
4420105	1	GH	—	hours 0.30